

# Your Personal Home Inspection



123 Somewhere Street  
Yourtown, US 12345

Prepared for: Bob Client

Prepared by: Downriver Home Inspections  
1234 Company Lane  
Somewhere, US 12345

## Table of Contents

Definitions	2
General Information	2
Lots and Grounds	3
Exterior	3
Roof	5
Garage	6
Electrical	7
Attic	8
Structure	9
Basement	10
Air Conditioning	11
Heating System	11
Fireplace/Wood Stove	12
Plumbing	12
Bathroom	13
Bedroom	15
Kitchen	16
Living Space	17
Laundry Room/Area	18
Summary	19

## Definitions

NOTE: All definitions listed below refer to the property or item listed as inspected on this report at the time of inspection

A	Acceptable	Functional with no obvious signs of defect.
NP	Not Present	Item not present or not found.
NI	Not Inspected	Item was unable to be inspected for safety reasons or due to lack of power, inaccessible, or disconnected at time of inspection.
M	Marginal	Item is not fully functional and requires repair or servicing.
D	Defective	Item needs immediate repair or replacement. It is unable to perform its intended function.

## General Information

### Property Information

Property Address 123 Somewhere Street  
City Yourtown State US Zip 12345  
Contact Name Sam Goodagent  
Phone 123-555-1234  
Email sam@goodagents.com

### Client Information

Client Name Bob Client  
Client Address 1234 Client Drive  
City Somewhere State OH Zip 12345  
Phone 123-555-2345  
Email bob@clients.com

### Inspection Company

Inspector Name Steven Gietzen  
Company Name Downriver Home Inspections  
Address 1234 Company Lane  
City Somewhere State US Zip 12345  
Phone 111-222-3333  
Email info@yourinspectioncompany.com

### Conditions

Others Present Buyer's Agent and Buyer Property Occupied Occupied  
Estimated Age 30 Entrance Faces East  
Inspection Date 05/03/2017  
Electric On  Yes  No  Not Applicable  
Gas/Oil On  Yes  No  Not Applicable  
Water On  Yes  No  Not Applicable  
Weather Partly cloudy Soil Conditions Dry  
Space Below Grade Basement  
Building Type Single family Garage Attached  
Water Source City How Verified Multiple Listing Service  
Sewage Disposal City How Verified Multiple Listing Service

## Lots and Grounds

This is the disclaimer section. Each category has a disclaimer section. In this section you can include any relevant text for the category. Common uses for this area include: standards of practice, what the inspector does/does not inspect, general information that the client may find helpful, etc.

There is no limit to the amount of information that is included in the section. It can be a few words or a few pages worth of information. You can also change the color and the font of the text.

A NP NI M D

- 1.      Driveway: Concrete
- 2.      Walks: Concrete
- 3.      Porch: Concrete **Settling away from foundation with surface cracks noted**



- 4.      Patio: Asphalt pavers
- 5.      Grading: Moderate slope
- 6.      Vegetation: Trees, Shrubs **Keep plantings trimmed away from foundation and roof areas**
- 7.      Window Wells: Drain present
- 8.      Retaining Walls: Stone
- 9.      Fences: Vinyl

## Exterior

A NP NI M D

### 1st Floor Exterior Surface

- 1.      Type: Brick veneer **Some damaged bricks, Recommend sealing brick with penetration sealer products**



### 2nd Floor Exterior Surface

## Exterior (Continued)

2.      Type: Vinyl siding Damaged front shutter, Chalking noted due to age, One panel needs to be repositioned at rear elevation



3.      Trim: Aluminum Chalking noted due to age, Loose nails in areas  
4.      Fascia: Aluminum  
5.      Soffits: Vinyl Loose/sagging at front porch  
6.      Door Bell: Hard wired  
7.      Entry Doors: Wood  
8.      Patio Door: Vinyl sliding Resecure loose handle hardware, Screen damage noted  
9.      Windows: Vinyl insulated Reseal caulking at window perimeters at brick window openings



10.      Window Screens: Metal  
11.      Basement Windows: Vinyl casement  
12.      Exterior Lighting: Surface mount  
13.      Exterior Electric Outlets: 110 VAC GFCI  
14.      Hose Bibs: Gate Properly secure fixture(s) to exterior wall with fasteners  
15.      Gas Meter: Exterior surface mount at side of home Rust present, Keep bushes and shrubs away from meter



16.      Main Gas Valve: Located at gas meter

## Roof

A NP NI M D

### Main Roof Surface

1. Method of Inspection: On roof



- 2.      Unable to Inspect: 0%
- 3.      Material: Fiberglass shingle
- 4. Type: Gable
- 5. Approximate Age: 5
- 6.      Flashing: Metal
- 7.      Plumbing Vents: Copper
- 8.      Electrical Mast: Underground utilities
- 9.      Gutters: Aluminum **Loose nails, Sagging gutters at front and rear**



- 10.      Downspouts: Aluminum
- 11.      Leader/Extension: Splash blocks **Splash block(s) not properly installed**



### Right side Chimney

- 12.      Chimney: Brick
- 13.      Flue/Flue Cap: Clay tile Weather cap obstructed view of flue



## Roof (Continued)

14.      Chimney Flashing: Galvanized

## Garage

A NP NI M D

### Attached Garage

---

1. Type of Structure: Attached Car Spaces: 2

2.      Garage Doors: Insulated aluminum

3.      Door Operation: Mechanized

4.      Door Opener: Overhead Door

5.      Exterior Surface: Brick veneer

6.      Roof: Asphalt shingle

7.      Roof Structure: 2x6 Rafter

8.      Service Doors: Wood **Wood rot at bottom of door and frame**



9.      Ceiling: Drywall

10.      Walls: Drywall **Hole(s) noted in walls**

11.      Floor/Foundation: Poured concrete **Minor floor cracks noted-seal cracks**

12.      Hose Bibs: Gate

13.      Electrical: 110 VAC **Fluorescent lighting missing covers and lenses**

14.      Smoke Detector:

15.      Windows: Vinyl Insulated


16.      Gutters: Aluminum

17.      Downspouts: Aluminum

## Electrical

A NP NI M D

1. Service Size Amps: 200 Volts: 120/240 VAC
2.      Service: Aluminum
3.      120 VAC Branch Circuits: Copper and aluminum *Evaluation by a licensed electrician is recommended, See aluminum wiring notes below*
4.      240 VAC Branch Circuits: Copper
5.      Aluminum Wiring: Present at several circuits *Aluminum branch wiring has had a history of problems relating to poor connections due to galvanic corrosion, dissimilar metals, brittle conductors and type of aluminum alloy used during the time period of 1965 through 1972. These problems create unsatisfactory conditions at connections and splice locations and therefore create potential fire hazards. Recommend wiring update for aluminum wiring by a licensed electrician, Circuits are recommended to be upgraded with special compression type connectors at splices and branch circuits to reduce the potential risks of aluminum branch wiring. (Cop-Alum Crimp System)*

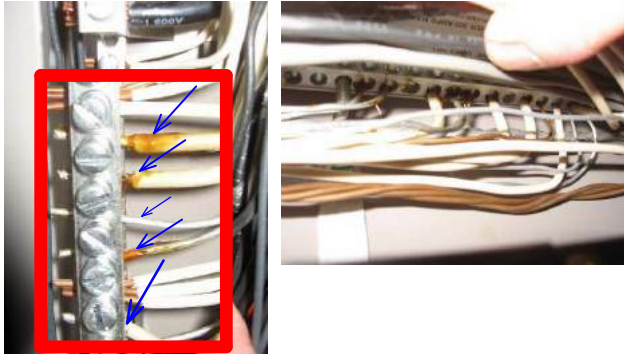

6.      Conductor Type: Romex, Non-metallic sheathed cable
7.      Ground: Plumbing and rod in ground
8.      Smoke Detectors: Hard wired with battery back up and light

Basement Electric Panel

9.      Manufacturer: Cutler-Hammer



10. Maximum Capacity: 200 Amps
11.      Main Breaker Size: 200 Amps
12.      Breakers: Copper
13.      AFCI: 110 volt
14.      GFCI: Present



## Electrical (Continued)

15. Is the panel bonded?  Yes  No

## Attic

A NP NI M D

### Attached Garage Attic

- 1. Method of Inspection: In the attic
- 2.      Unable to Inspect: 15% Safety and footing
- 3.      Roof Framing: 2x3/4 Truss Wood blocking components missing at chimney perimeter




- 4.      Sheathing: Plywood Water stains and slight damage present, Areas of sheathing have been repaired



- 5.      Ventilation: Ridge and soffit vents
- 6.      Insulation: Fiberglass loose fill
- 7.      Insulation Depth: 4"
- 8.      Wiring/Lighting: 110 VAC

### Main Attic

- 9. Method of Inspection: In the attic
- 10.      Unable to Inspect: 10% Safety and footing
- 11.      Roof Framing: 2x3/4 Truss
- 12.      Sheathing: Plywood Poor repair at 2 areas near ridge at rear slope - No H clips installed and repair only spanned one truss - Recommend additional support be installed

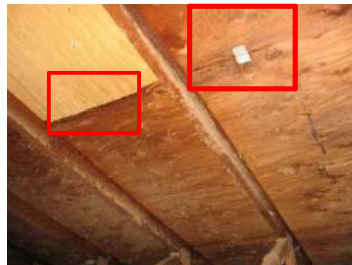

## Attic (Continued)

- 13.      Ventilation: Gable vent(s), Ridge vent(s)
- 14.      Insulation: Fiberglass loose fill
- 15.      Insulation Depth: 6"

## Structure

A NP NI M D

- 1.      Structure Type: Wood frame
- 2.      Foundation: Poured concrete
- 3.      Differential Movement: Slight settlement present Minor settlement at front porch, Cracks will require monitoring
- 4.      Beams: Steel I-Beam
- 5.      Bearing Walls: Wood frame
- 6.      Joists/Trusses: 2x10 Areas not visible due to ceiling finishes or other obstructions, Framing joist near fireplace chimney shows evidence of previous termite infestation - No repairs required, Seal penetration as required



- 7.      Piers/Posts: Steel posts
- 8.      Stairs/Handrails: Wood stairs with wood handrails
- 9.      Subfloor: Plywood

## Basement


A NP NI M D

### Main Basement

1.      Unable to Inspect: 0%



- 2.      Ceiling: Suspended Acoustical System Evidence of past water staining
- 3.      Walls: Drywall
- 4.      Floor: Carpet Carpet stains noted
- 5.      Floor Drain: Surface drain
- 6.      Doors: Hollow wood
- 7.      Windows: Vinyl casement
- 8.      Electrical: 110 VAC Loose junction boxes, missing and mis-sized covers, extension cord wiring to projector

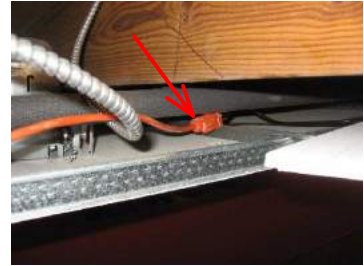

- 9.      HVAC Source: Air exchange ventilation
- 10.      Insulation: Fiberglass insulation at rim joist areas
- 11.      Ventilation: Windows
- 12.      Sump Pump: Submerged
- 13.      Basement Stairs/Railings: Wood stairs with wood handrails

## Air Conditioning

A NP NI M D

### Main AC System

- 1.      A/C System Operation: Appears serviceable
- 2.      Condensate Removal: Plastic tubing
- 3.      Exterior Unit: Pad mounted



- 4. Manufacturer: Rheem
- 5. Area Served: whole house Approximate Age: 7
- 6. Fuel Type: 110 VAC Temperature Differential: 16 degrees
- 7. Type: Central A/C Capacity: 3 Ton
- 8.      Visible Coil: Copper core with aluminum fins
- 9.      Refrigerant Lines: Serviceable condition
- 10.      Electrical Disconnect: Breaker disconnect
- 11.      Exposed Ductwork: Metal
- 12.      Blower Fan/Filters: Direct drive with electronic filter
- 13.      Thermostats: Single Zone

## Heating System

A NP NI M D

### Basement Heating System

- 1.      Heating System Operation: Appears functional



- 2. Manufacturer: Ducane
- 3. Type: Forced air Capacity: 100,000 BTUHR
- 4. Area Served: whole house Approximate Age: 6
- 5. Fuel Type: Natural gas
- 6.      Heat Exchanger: 5 Burner
- 7. Unable to Inspect: 20%

## Heating System (Continued)

- 8.      Blower Fan/Filter: Direct drive with electronic filter
- 9.      Distribution: Metal duct
- 10.      Draft Control: Automatic
- 11.      Flue Pipe: Double wall
- 12.      Controls: Limit switch
- 13.      Humidifier: General **Inoperative - Requires service/replacement**
- 14.      Thermostats: Single Zone
- 15. Suspected Asbestos: No

## Fireplace/Wood Stove

A NP NI M D

### Family Room Fireplace

- 1.      Fireplace Construction: Masonry
- 2. Type: Wood burning
- 3.      Fireplace Insert: Standard
- 4.      Smoke Chamber: Brick
- 5.      Flue: Clay tile
- 6.      Damper: Metal
- 7.      Hearth: Raised

## Plumbing

A NP NI M D

- 1.      Service Line: Copper
- 2.      Main Water Shutoff: Basement
- 3.      Water Lines: Copper
- 4.      Drain Pipes: Cast iron, Copper **Pitting cast iron drain piping stack - replace affected sections where required**



- 5.      Service Caps: Accessible
- 6.      Vent Pipes: Copper
- 7.      Gas Service Lines: Black Iron

# Downriver Home Inspections

10:08 December 22, 2021

Page 13 of 25  
Example.inspx

## Plumbing (Continued)

### Utility Room Water Heater

8.      Water Heater Operation: Functional at time of inspection  
9. Manufacturer: Ruud  
10. Type: Natural gas Capacity: 40 Gal.  
11. Approximate Age: 9 Area Served: Whole house  
12.      Flue Pipe: Single wall metal  
13.      TPRV and Drain Tube: Brass/Copper

## Bathroom

A NP NI M D

### Master Bathroom

1.      Ceiling: Drywall  
2.      Walls: Drywall  
3.      Floor: Laminated flooring **Gapping noted in planks**  
4.      Doors: Hollow wood  
5.      Windows: Vinyl Insulated  
6.      Electrical: GFCI  
7.      Counter/Cabinet: Wood  
8.      Sink/Basin: One piece sink/counter top  
9.      Faucets/Traps: Delta  
10.      Shower/Surround: Ceramic tile **Leaking at corner of door frame**




11.      Toilets: Porcelain  
12.      HVAC Source: Air exchange ventilation  
13.      Ventilation: Window

### 2nd Floor Hall Bathroom

14.      Closet: Large **Alignment needed at closet doors**  
15.      Ceiling: Drywall  
16.      Walls: Drywall  
17.      Floor: Laminated flooring **Gapping noted in planks**  
18.      Doors: Hollow wood  
19.      Windows: Vinyl Insulated  
20.      Electrical: GFCI  
21.      Counter/Cabinet: Wood  
22.      Sink/Basin: One piece sink/counter top

## Bathroom (Continued)

23.      Faucets/Traps: Delta fixtures with a metal trap **Leaking shower head, Loose trim rings**

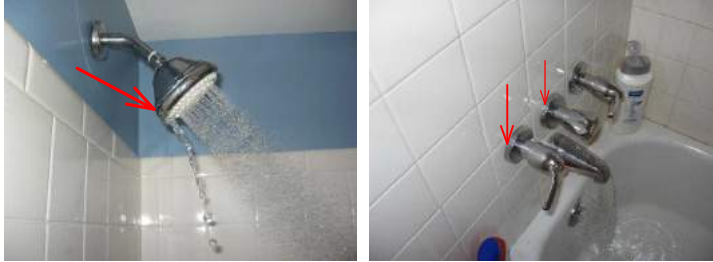

24.      Tub/Surround: Porcelain tub and ceramic tile surround  
25.      Toilets: Porcelain  
26.      HVAC Source: Air exchange ventilation  
27.      Ventilation: Window

1st Floor Hall Half Bathroom

---

28.      Ceiling: Drywall  
29.      Walls: Drywall  
30.      Floor: Ceramic tile **Cracked tile noted**



31.      Doors: Solid wood  
32.      Windows: Vinyl Insulated  
33.      Electrical: GFCI  
34.      Counter/Cabinet: Laminate and wood  
35.      Sink/Basin: One piece sink/counter top  
36.      Faucets/Traps: Delta fixtures with a metal trap  
37.      Toilets: Porcelain  
38.      HVAC Source: Air exchange ventilation  
39.      Ventilation: Window

# Downriver Home Inspections

10:08 December 22, 2021

Page 15 of 25  
Example.inspx

## Bedroom

A NP NI M D

### 2nd Floor Master Bedroom

---

- 1.      Closet: Walk In and Large
- 2.      Ceiling: Drywall
- 3.      Walls: Drywall
- 4.      Floor: Carpet
- 5.      Doors: Solid wood
- 6.      Windows: Vinyl Insulated
- 7.      Electrical: 110 VAC
- 8.      HVAC Source: Air exchange ventilation
- 9.      Smoke Detector: Hard wired with battery back up and light

### Middle Bedroom

---

- 10.      Closet: Large
- 11.      Ceiling: Drywall
- 12.      Walls: Drywall
- 13.      Floor: Carpet
- 14.      Doors: Hollow wood
- 15.      Windows: Vinyl Insulated
- 16.      Electrical: 110 VAC
- 17.      HVAC Source: Air exchange ventilation
- 18.      Smoke Detector: Hard wired with battery back up and light in 2nd floor hallway

### Southeast Bedroom

---

- 19.      Closet: Large
- 20.      Ceiling: Drywall
- 21.      Walls: Drywall
- 22.      Floor: Carpet
- 23.      Doors: Solid wood
- 24.      Windows: Vinyl Insulated
- 25.      Electrical: 110 VAC
- 26.      HVAC Source: Air exchange ventilation
- 27.      Smoke Detector: Hard wired with battery back up and light in 2nd floor hallway

### Southwest Bedroom

---

- 28.      Closet: Large
- 29.      Ceiling: Drywall
- 30.      Walls: Drywall
- 31.      Floor: Hardwood
- 32.      Doors: Hollow wood
- 33.      Windows: Vinyl Insulated
- 34.      Electrical: 110 VAC
- 35.      HVAC Source: Air exchange ventilation
- 36.      Smoke Detector: Hard wired with battery back up and light in 2nd floor hallway



## Kitchen

A NP NI M D

### 1st Floor Kitchen

- 1.      Cooking Appliances: Frigidaire
- 2.      Disposal: General Electric
- 3.      Dishwasher: Maytag **Properly secure the dishwasher discharge hose so that it creates a "high loop" above the basin drain to minimize food or water backup under dishwasher**



- 4. Air Gap Present?  Yes  No
- 5.      Refrigerator: Amana
- 6.      Microwave: General Electric
- 7.      Sink: Stainless Steel **Chipping at drain**
- 8.      Electrical: 110 VAC GFCI
- 9.      Plumbing/Fixtures: Stainless Steel
- 10.      Counter Tops: Solid Surface
- 11.      Cabinets: Wood Loose cabinet door hinges
- 12.      Pantry: Large
- 13.      Ceiling: Drywall
- 14.      Walls: Drywall
- 15.      Floor: Ceramic tile
- 16.      Doors: Hollow wood
- 17.      Windows: Vinyl Insulated **Insulated glass unit seal failure**



- 18.      HVAC Source: Air exchange ventilation

## Living Space

A NP NI M D

### 1st Floor Living Space

1.      Closet: Various Missing door glides at bypass closet door in Foyer



2.      Ceiling: Drywall

3.      Walls: Drywall

4.      Floor: Ceramic tile, Carpet, Hardwood Worn wood finish in Family room



5.      Doors: Solid wood

6.      Windows: Vinyl Insulated

7.      Electrical: 110 VAC Replace missing dimmer switch in Dining room



8.      HVAC Source: Air exchange ventilation

9.      Smoke Detector: Hard wired with battery back up and light

## Laundry Room/Area

A NP NI M D

### Basement Laundry Room/Area

---

- |     |                                     |                          |                          |                          |                          |   |
|-----|-------------------------------------|--------------------------|--------------------------|--------------------------|--------------------------|---|
| 1.  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | Ceiling: Exposed framing                                  |
| 2.  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | Walls: Concrete   |
| 3.  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | Floor: Poured   |
| 4.  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | Doors: Hollow wood  |
| 5.  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | Electrical: 110 VAC                                       |
| 6.  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | Smoke Detector: Hard wired with battery back up and light |
| 7.  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | HVAC Source: Air exchange ventilation                     |
| 8.  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | Laundry Tub: Concrete                                     |
| 9.  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | Laundry Tub Drain: Copper                                 |
| 10. | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | Washer Hose Bib: Gate valves                              |
| 11. | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | Washer and Dryer Electrical: 120/240 VAC                  |
| 12. | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | Dryer Vent: Metal flex                                    |
| 13. | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | Washer Drain: Drains to laundry tub                       |
| 14. | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | Floor Drain: Surface drain                                |

## Final Comments

This is a place to enter any final comments that will appear in the inspection report after the body of the report.

## Marginal Summary

This summary is not the entire report. The complete report may include additional information of concern to the client. It is recommended that the client read the complete report.

### Lots and Grounds

1. Vegetation: Trees, Shrubs Keep plantings trimmed away from foundation and roof areas

### Exterior


2. 1st Floor Exterior Surface Type: Brick veneer Some damaged bricks, Recommend sealing brick with penetration sealer products



3. 2nd Floor Exterior Surface Type: Vinyl siding Damaged front shutter, Chalking noted due to age, One panel needs to be repositioned at rear elevation



4. Trim: Aluminum Chalking noted due to age, Loose nails in areas
5. Soffits: Vinyl Loose/sagging at front porch
6. Patio Door: Vinyl sliding Resecure loose handle hardware, Screen damage noted
7. Windows: Vinyl insulated Reseal caulking at window perimeters at brick window openings

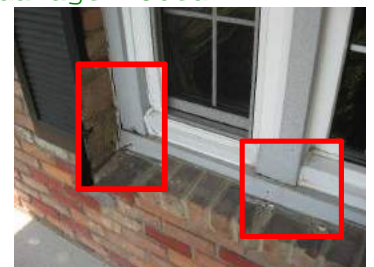

8. Hose Bibs: Gate Properly secure fixture(s) to exterior wall with fasteners

### Roof

9. Gutters: Aluminum Loose nails, Sagging gutters at front and rear



## Marginal Summary (Continued)

10. Leader/Extension: Splash blocks Splash block(s) not properly installed




## Garage

11. Attached Garage Walls: Drywall Hole(s) noted in walls  
12. Attached Garage Floor/Foundation: Poured concrete Minor floor cracks noted-seal cracks  
13. Attached Garage Electrical: 110 VAC Fluorescent lighting missing covers and lenses

## Electrical

14. 120 VAC Branch Circuits: Copper and aluminum Evaluation by a licensed electrician is recommended, See aluminum wiring notes below  
15. Aluminum Wiring: Present at several circuits Aluminum branch wiring has had a history of problems relating to poor connections due to galvanic corrosion, dissimilar metals, brittle conductors and type of aluminum alloy used during the time period of 1965 through 1972. These problems create unsatisfactory conditions at connections and splice locations and therefore create potential fire hazards. Recommend wiring update for aluminum wiring by a licensed electrician, Circuits are recommended to be upgraded with special compression type connectors at splices and branch circuits to reduce the potential risks of aluminum branch wiring. (Cop-Alum Crimp System)

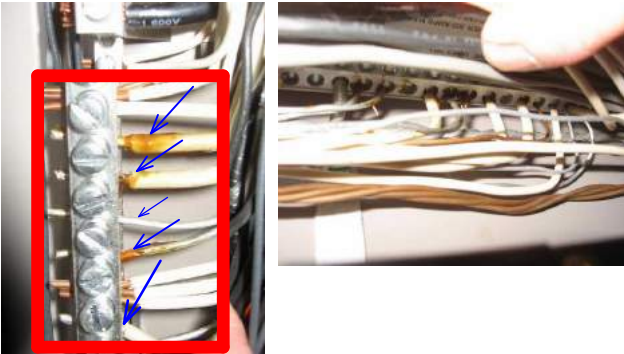

## Attic

16. Attached Garage Attic Roof Framing: 2x3/4 Truss Wood blocking components missing at chimney perimeter



## Marginal Summary (Continued)

17. Attached Garage Attic Sheathing: Plywood Water stains and slight damage present, Areas of sheathing have been repaired



18. Main Attic Sheathing: Plywood Poor repair at 2 areas near ridge at rear slope - No H clips installed and repair only spanned one truss - Recommend additional support be installed



## Structure

19. Joists/Trusses: 2x10 Areas not visible due to ceiling finishes or other obstructions, Framing joist near fireplace chimney shows evidence of previous termite infestation - No repairs required, Seal penetration as required



## Basement

20. Main Basement Floor: Carpet Carpet stains noted  
21. Main Basement Electrical: 110 VAC Loose junction boxes, missing and mis-sized covers, extension cord wiring to projector



## Marginal Summary (Continued)

### Bathroom

- 22. Master Bathroom Floor: Laminated flooring Gapping noted in planks
- 23. Master Bathroom Shower/Surround: Ceramic tile Leaking at corner of door frame



- 24. 2nd Floor Hall Bathroom Closet: Large Alignment needed at closet doors
- 25. 2nd Floor Hall Bathroom Floor: Laminated flooring Gapping noted in planks
- 26. 1st Floor Hall Half Bathroom Floor: Ceramic tile Cracked tile noted



### Kitchen

- 27. 1st Floor Kitchen Dishwasher: Maytag Properly secure the dishwasher discharge hose so that it creates a "high loop" above the basin drain to minimize food or water backup under dishwasher



- 28. 1st Floor Kitchen Sink: Stainless Steel Chipping at drain

### Living Space

- 29. 1st Floor Living Space Closet: Various Missing door glides at bypass closet door in Foyer



- 30. 1st Floor Living Space Floor: Ceramic tile, Carpet, Hardwood Worn wood finish in Family room

## Living Space (Continued)

Floor: (continued)





## Defective Summary

This summary is not the entire report. The complete report may include additional information of concern to the client. It is recommended that the client read the complete report.

### Lots and Grounds

1. Porch: Concrete **Settling away from foundation with surface cracks noted**



### Garage

2. Attached Garage Service Doors: wood **Wood rot at bottom of door and frame**



### Heating System

3. Basement Heating System Humidifier: General **Inoperative - Requires service/replacement**

### Plumbing

4. Drain Pipes: Cast iron, Copper **Pitting cast iron drain piping stack - replace affected sections where required**



### Bathroom

5. 2nd Floor Hall Bathroom Faucets/Traps: Delta fixtures with a metal trap **Leaking shower head, Loose trim rings**

## Bathroom (Continued)

Faucets/Traps: (continued)



## Kitchen

6. 1st Floor Kitchen Windows: Vinyl Insulated Insulated glass unit seal failure

